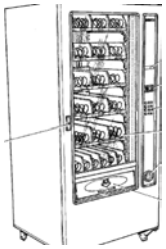

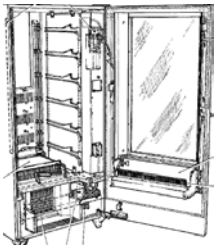

Technical Update (July 2003)

Spring Snack vend flap modification

Following recent experiences, we have noticed a number of cases where the vend flap on the Spring Snack machine jams and will not open occasionally

Problem

1. The mechanism for the vend flap, overrides on its mounting bracket and restricts its movement

2. The problem happens occasionally and prevents the vend flap from being opened

Possible cause

There is nothing to stop the mechanism from overriding onto its mounting

Rectification

Add a washer to the mechanism assembly, which prevents the override occurring

We can supply a washer of the correct dimensions, the part number is .

Washer to be added here
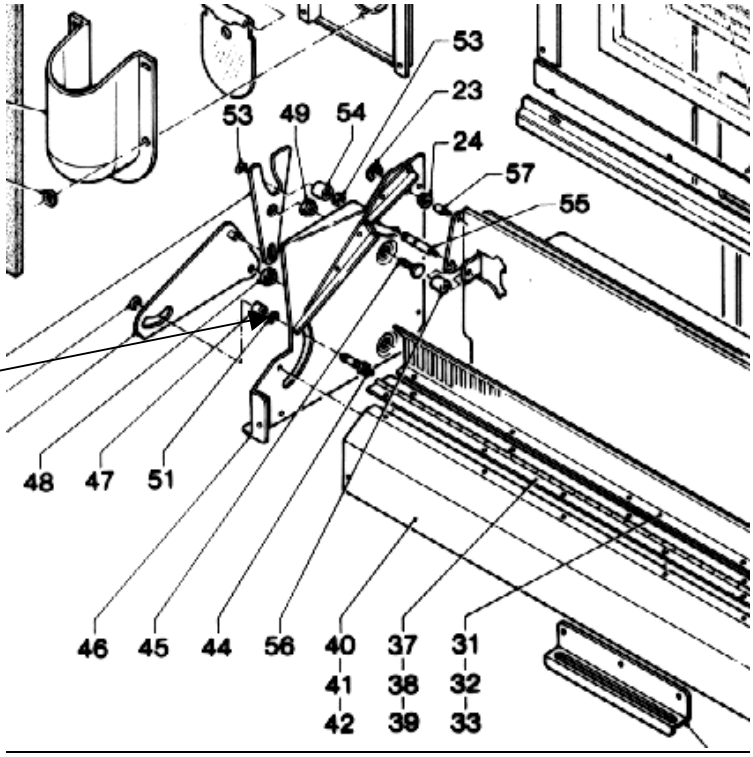
Also see attached photo's